Administration, operation and maintenance Dekso AÏR

Product description

Dekso AÏR is a premium product with special allergy-friendly properties.



Properties

Matt 100 % acrylic paint. Recommended for premises with high functional and special aesthetic requirements where consideration is given to people with allergies.

Application area

Living rooms, bedrooms and other living spaces. Felt and glass tissue, wallpaper, concrete, lightweight concrete and well-bonded plaster. The condition is that the substrate is clean, dry, solid and suitable for surface treatment.

Environmental labeling



Application information, instructions for use and technical specifications:

See the product's technical data sheet.

Cleaning

Gentle cleaning

The surface is painted, intact and fixed, with dust or other loose, dry soiling. The surface can withstand dusting and/or vacuuming.

General cleaning

The surface is painted, intact, fixed and soiled by dust and dirt. The surface withstands cleaning with mild detergents without abrasives, water and wiping with a damp cloth. Spot cleaning on matte surfaces can cause shielding and polishing. Be aware that excessive use of water can damage the surface.

Recommended cleaning agent

Flügger Fluren 37 Basic cleaner, universal cleaning, or similar.

Flügger Group A/S Islevdalvej 151 DK-2610 Rødovre Tel. +45 70 15 15 05 flugger@flugger.com flugger.dk flugger.com CVR 45240118

Version:

February/2024

Page: 1/4

Maintenance

Simple maintenance

Condition: The surface is matt, even or structured, intact with a few small holes and cracks. Open pores may occur. Existing paint is firm and durable without significant chalking and without risk of strike-through due to nicotine or water shields.

The surface is slightly soiled/faded.

Maintenance: The surface is washed with subsequent spot-spackling of small holes and cracks, after which the surface is painted. Since it is only painted once, the choice of color is limited to shades that do not deviate significantly from the substrate.

General maintenance

Condition: The surface is matt, with structure and/or unevenness. Open pores may occur. Largely intact with a few small holes and cracks. Existing paint is firm and durable, with no risk of strike-through due to nicotine or water shields, and without significant chalking. The surface is soiled/faded.

Maintenance: The surface is washed with subsequent spackling to fill holes and other unevenness, so that the surface appears smooth and uniform. Since it is painted twice, the choice of color is not limited to shades that do not deviate significantly from the substrate.

Repair of damage

Damage is repaired immediately with the same product that was used when the painting work was carried out. Repair of damage must be carried out in such a way that it does not deviate from current treatment. See project schedule for products used in preparation and processing.

The same product is used for re-painting. Contact dealer or painting company.

Spot repair

In general, it is not possible to carry out spot repair/spot painting without visible traces. Surface structure, light incidence and viewing angle are decisive for how clearly spot repairs appear.

On smooth surfaces, when exposed to direct light through glass areas, exposure from electric light sources and when viewed in side light, spot repairs will always appear visible to a greater or lesser extent. Always try to remove marks, dirt and grime when cleaning.

Repair must always be carried out with the same material and batch number as originally used. The best results are achieved on structured surfaces, which are viewed at right angles and in shadow. Major damage is repaired, if possible, with tools similar to what was originally used. Where it is not possible to repair major damage acceptably by spot repair, entire wall areas are treated with demarcation up to corners, joints and the like.

Flügger Group A/S Islevdalvej 151 DK-2610 Rødovre Tel. +45 70 15 15 05 flugger@flugger.com flugger.dk flugger.com CVR 45240118

Flügge

Version:

February/2024

Page: 2/4

Storage

Unopened and opened packaging should be kept cool, frost-free and tightly closed.

Waste management

Remove as much paint as possible from tools before cleaning. Do not pour leftover liquid paint down the drain, hand it in at the local recycling station. Minimize your paint waste by pre-estimating how much paint you need. Store excess paint correctly so that leftovers can be used, thus minimizing environmental impact. Empty packaging is delivered to the nearest recycling station.

Environmentally certified construction

Documentation for environmentally certified construction etc. can be downloaded in the Flügger Document Manager

Health and safety

Pay attention to the environmental and safety labeling indicated on the packaging. A safety data sheet has been prepared for professional users. Detailed information regarding health and safety risks and precautions when using this product is specified in the product safety data sheet.

First aid: see section 4 in SDS Handling and storage: see section 7 in SDS Transport information: see section 14 in SDS Information on laws and executive orders: see section 15 in SDS VOC: see section 2.3 in SDS

Reservation

The information in this document is based on extensive laboratory tests and practical experience. As the conditions under which the products are used are beyond our control, we cannot guarantee anything other than the quality of the product. We reserve the right to change the data provided without notice. The paint can be considered a semi-finished product. The end result depends on the nature of the substrate, pretreatment, temperature, humidity, application, etc.

Flügger Group A/S Islevdalvej 151 DK-2610 Rødovre Tel. +45 70 15 15 05 flugger@flugger.com flugger.dk flugger.com CVR 45240118


Flugge

Version:

February/2024

Page: 3/4

Administration, operation and maintenance Dekso AÏR

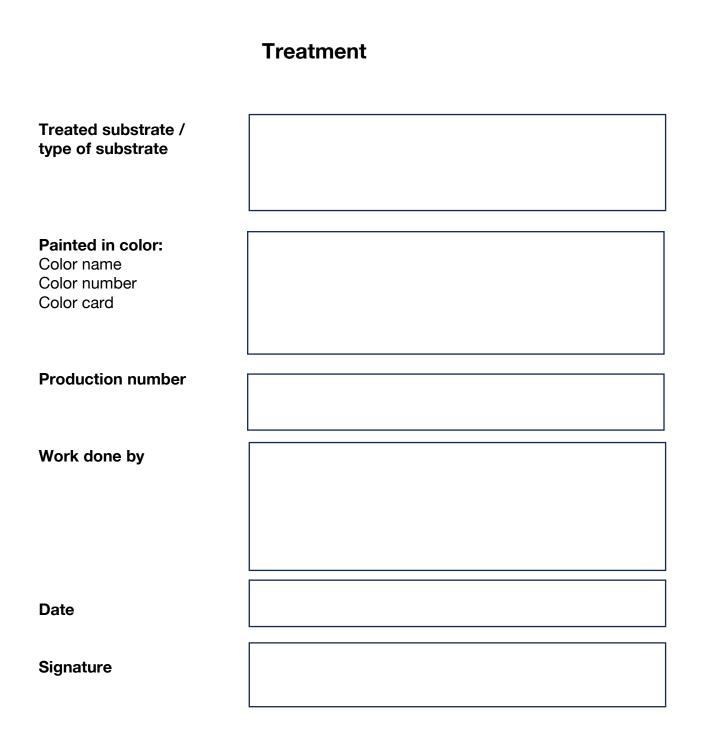

Flügger Group A/S Islevdalvej 151 DK-2610 Rødovre Tel. +45 70 15 15 05 flugger@flugger.com

flugger.dk flugger.com CVR 45240118

Flügger

Version:

February/2024

Page: 4/4